


# TK TENSION GAUGES

Demonstrating KANON's measuring versatility.  
Great performance whether measuring vertically or horizontally.

## FEATURES

- Measures pushing, pulling force and spring tension.  
Our tension gauges are designed to indicate precise increments of force.
- Use the gauges for taking horizontal measurements. Just add the correcting value to the indicated value (see the table below). A peak indicator is available for TK500 to TK300 and TK500cN to TK3000cN.
- Accuracy :  $\pm 1$  increment

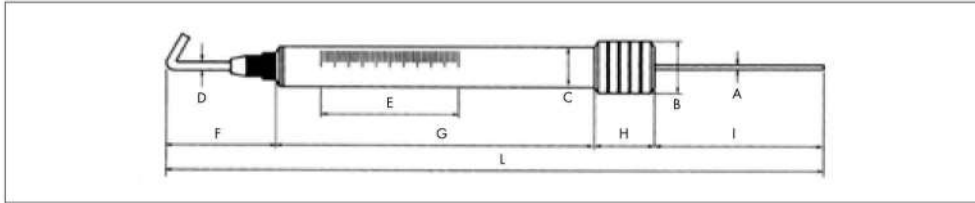

Model (g)	Range (g)	Incr. (g)	A mm	B mm	C mm	D mm	E mm	F mm	G mm	H mm	I mm	L mm	Weight (g)	Correcting value for horizontal measurements (g)
TK10	0 ~ 10	0.5	1.5	16	13	1.5	40	19	98	15	48	180	30	3
TK30	0 ~ 30	1	1.5	16	13	1.5	60	19	113	15	66	213	30	3
TK50	0 ~ 50	1	1.5	16	13	1.5	60	19	113	15	66	213	30	3
TK110	0 ~ 110	2	2	16	13	2	60	27.5	113	15	65.5	221	35	10
TK200	0 ~ 200	5	2	16	13	2	60	27.5	113	15	65.5	221	35	10
TK300	0 ~ 300	5	2	16	13	2	60	27.5	113	15	65.5	221	35	10
TK500	0 ~ 500	10	3	20	16	2.6	56	43	131	25	69	268	78	30
TK600	0 ~ 600	20	3	20	16	2.6	56	43	131	25	69	268	78	30
TK1000	0 ~ 1000	25	3	20	16	2.6	56	43	131	25	69	268	78	30
TK1500	0 ~ 1500	50	3	20	16	2.6	56	43	131	25	69	268	78	30
TK2000	0 ~ 2000	50	3	20	16	2.6	56	43	131	25	69	268	78	30
TK2500	0 ~ 2500	50	3	20	16	2.6	62	43	143	25	74	285	85	50
TK3000	0 ~ 3000	50	3	20	16	2.6	62	43	143	25	74	285	85	50
TK4000	0 ~ 4000	50	4	25	22	3.5	68	43	178	35	82	338	200	100
TK5000	0 ~ 5000	100	4	25	22	3.5	68	43	178	35	82	338	200	100
TK7000	0 ~ 7000	200	4	25	22	3.5	68	43	178	35	82	338	205	100
TK10000	0 ~ 10000	200	4	25	22	3.5	68	43	178	35	82	338	205	100
TK15000	0 ~ 15000	200	8	35	32	7	95	83	230	35	145	493	600	250
TK20000	0 ~ 20000	200	8	35	32	7	118	83	280	35	140	538	680	250
TK30000	0 ~ 30000	500	8	40	38	7	130	83	305	35	172	595	830	350

Model (cN)	Range (cN)	Incr. (cN)	A mm	B mm	C mm	D mm	E mm	F mm	G mm	H mm	I mm	L mm	Weight (g)	Correcting value for horizontal measurements (c-N)
TK10cN	0 ~ 10	0.5	1.5	16	13	1.5	40	19	98	15	48	180	30	3
TK30cN	0 ~ 30	1	1.5	16	13	1.5	60	19	113	15	66	213	30	3
TK50cN	0 ~ 50	1	1.5	16	13	1.5	60	19	113	15	66	213	30	3
TK110cN	0 ~ 110	2	2	16	13	2	60	27.5	113	15	65.5	221	35	10
TK200cN	0 ~ 200	5	2	16	13	2	60	27.5	113	15	65.5	221	35	10
TK300cN	0 ~ 300	5	2	16	13	2	60	27.5	113	15	65.5	221	35	10
TK500cN	0 ~ 500	10	3	20	16	2.6	56	43	131	25	69	268	78	30
TK600cN	0 ~ 600	20	3	20	16	2.6	56	43	131	25	69	268	78	30
TK1000cN	0 ~ 1000	25	3	20	16	2.6	56	43	131	25	69	268	78	30
TK1500cN	0 ~ 1500	50	3	20	16	2.6	56	43	131	25	69	268	78	30
TK2000cN	0 ~ 2000	50	3	20	16	2.6	56	43	131	25	69	268	78	30
TK2500cN	0 ~ 2500	50	3	20	16	2.6	62	43	143	25	74	285	85	50
TK3000cN	0 ~ 3000	50	3	20	16	2.6	62	43	143	25	74	285	85	50
TK4000cN	0 ~ 4000	50	4	25	22	3.5	68	43	178	35	82	338	200	100
TK5000cN	0 ~ 5000	100	4	25	22	3.5	68	43	178	35	82	338	200	100
TK7000cN	0 ~ 7000	200	4	25	22	3.5	68	43	178	35	82	338	205	100
TK10000cN	0 ~ 10000	200	4	25	22	3.5	68	43	178	35	82	338	205	100
TK15000cN	0 ~ 15000	200	8	35	32	7	95	83	230	35	145	493	600	250
TK20000cN	0 ~ 20000	200	8	35	32	7	118	83	280	35	140	538	680	250
TK30000cN	0 ~ 30000	500	8	40	38	7	130	83	305	35	172	595	830	350



- If you take a measurement horizontally, add the correcting value to the indicated measurement value per the table.



\* Peak indicator is optional

- If you would like your TK gauge with a peak indicator, please specify "TK-G" on your purchase order.  
ex). TK500cN-G